

Date: Thursday, 29/05/2008 9:05:58 AM
 User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	FWD X-TUBE EXTENDED HEIGHT GEAR (-011)
Job Number :	39552		
Estimate Number :	10007		
P.O. Number :		Part Number :	D205596101
This Issue :	29/05/2008	Drawing Number :	D205-596-101
Prsht Rev. :	NC	Project Number :	N/A
First Issue :	/ /	Drawing Revision :	B
Previous Run :	39551	Material :	
Written By :		Due Date :	13/06/2008
Checked & Approved By :	JUD08.5.29	Qty:	1 Um: Each
Comment :	Est Rev G Removed Bending 05-10-25 JLM Est Rev:H ECN 1075 08-01-10 DD Est Rev F 08.04.28 Added bending & mat'l EC verified by: DD		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------

**Comment:** DOCUMENT CONTROL

Photocopy D205-594 bluefile & type labels per PPP D205-596-101 CHG002

2.0	D6005180	Crosstube Material
-----	----------	--------------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Crosstube Material

Batch: B34767

①

M

8-7-17

3.0	BENDING	BENDING MACHINE - SKIDTUBES
-----	---------	-----------------------------

**Comment:** BENDING MACHINE

Bend as per Dwg D2889 using CNC bender program

EL 8-7-18

4.0	CROSSTUBES	CROSSTUBES RESOURCE 1
-----	------------	-----------------------

**Comment:** LANDING GEAR RESOURCE 1

Mark 31.53" for cutting from tangential line in the straight section from D2889 as per Dwg wall template.

Identify off-cuts with batch number & part number and bring them to cnc lathe

EL

8-7-17

5.0	QC15	DIMENSIONAL CHECK OF X-TUBES
-----	------	------------------------------

**Comment:** DIMENSIONAL CHECK OF X-TUBES

808/7/18 (x)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 29/05/2008 9:05:58 AM
User: Julie Lecoq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD X-TUBE EXTENDED HEIGHT GEAR (-011)

Job Number: 39552

Part Number: D205596101

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Cut as per Dwg D205-596-101

EL 8-7-18

2-Deburr & Inspect for surface damage. Polish cut surface. Scribe part # and end of tube.

Batch # on one

AUM 8-7-21

7.0

QC15

DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES

508/2/21 (X)

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat per QSI 005 4.1

AUM 8-7-21

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

508/2/21 (X)

10.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

Prime inside and outside with Immron per QSI 005 4.2

ml 08 01 24

(1)

11.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

080725 (X)

12.0

D3595063450

RUBBER CUSHION



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

RUBBER CUSHION

batch 38959

ml 08 07 25

13.0

MS2192025

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Clamp(per MIL-DTL-8783C)

batch 108224

ml 08 07 25

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 29/05/2008 9:05:58 AM
User: Julie Lecoq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD X-TUBE EXTENDED HEIGHT_GEAR (-011)

Job Number: 39552

Part Number: D205596101

Job Number:



Seq. #:

Machine Or Operation:

Description :

14.0

D28931

2.75 Support



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Support

Pick:

Qty Part number Description Batch

2 D2893-1 Support

38614

ml

08 07 25

15.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

ml

08 07 25 (1)

2- Apply magnobond 6398 as per dwg D205-596-101.

Magnobond 6398 Batch: 107621

EXP: 08/2009 Time: 10:15am

3 - install supports and clamps as per Dwg D205-596-101. Torque clamps to 80-100 in lb. as per dwg

ml

08 07 28 (1)

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08-07-28 (1)

17.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

NCA

PIC

18.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-596-101

Location:

Rev F

AS

08/07/28

(X)

19.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE


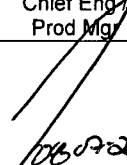
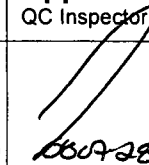
08/07/28

Job Completion



mf 08-07-28

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng Prod Mgr	Approval QC Inspector
08-28	17-0	QC 4 not required. Remove. 					

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order: 39552
Description: Crosstube High-High Fwd		Part Number: D205-596-101
Inspection Dwg: D205-596-101 Rev: B		Page 1 of 1

Required Dimension	Min	Max
Height	38.2	38.4
1/2 Span	59.5	59.7
Angle	49	52
Total Span	119.0	119.4

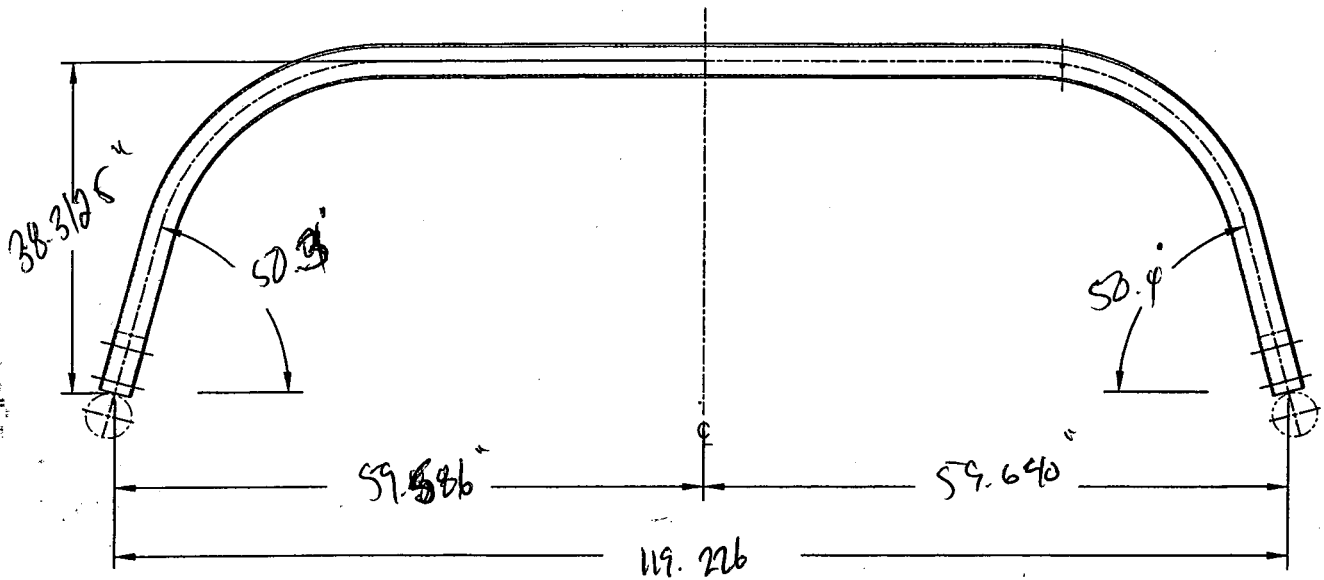

Comments

QC15 Inspection	60/7/28
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	08.04.21	Dwg Rev updated	KJ/JM	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

PARTS LIST:

Qty	Part Number	Description
X	D205-596-101	CROSSTUBE ASSEMBLY, HI-HI FWD
1	D6005-180	CROSSTUBE
2	D2893-1	SUPPORT
4	D3595-063-450	RUBBER CUSHION
4	MS21920-25	CLAMP
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURE FROM D6005-180
FINISHED LENGTH = 149.60 ± 0.02
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART 005 4.2
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH
VIBRATING STYLUS
- 7) WEIGHT: 44 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE
- 9) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) APPLY A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT
WILL BE IN CONTACT WITH THE CROSSTUBE. LET CURE FOR 12 HOURS AFTER INSTALLATION
AND PRIOR TO PACKAGING.
- 12) INSTALL MS21920-25 CLAMPS WITH D3595-063-450 RUBBER CUSHIONS TO SECURE D2893-1
SUPPORT ON THE TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE
CROSSTUBE SUPPORT.
**NOTE: IT IS ACCEPTABLE TO SUBSTITUTE MS21920-25 CLAMPS WITH LONGER (MS21920-26) OR
SHORTER (MS21920-24) CLAMPS TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A
MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.**
- 13) TORQUE CLAMPS 80 TO 100 IN-LB

SHOP COPY
RETURN TO
ENGINEERING


CONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE
WORK ORDER

NO. 39552

RELEASED
R 60-01-16 WP

B	SUPPORT NOW MAGNOBONDED; REMOVE D2856-600-851 ABRASION STRIP; UPDATED NOTES; ADDED D3595-063-450 CUSHION; MS21920-25 WAS MS21920-24	MB	07.12.03
A	NEW ISSUE	DS	02.05.27
REV.	DESCRIPTION	BY	DATE
DESIGN	<i>[Signature]</i>	DART AEROSPACE LTD	
DRAWN	<i>[Signature]</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. B
MFG. APPR.	<i>[Signature]</i>	D205-596-101	SHEET 1 OF 2
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	CROSSTUBE ASSEMBLY, HI-HI FWD	NTS
DATE	07.12.03	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

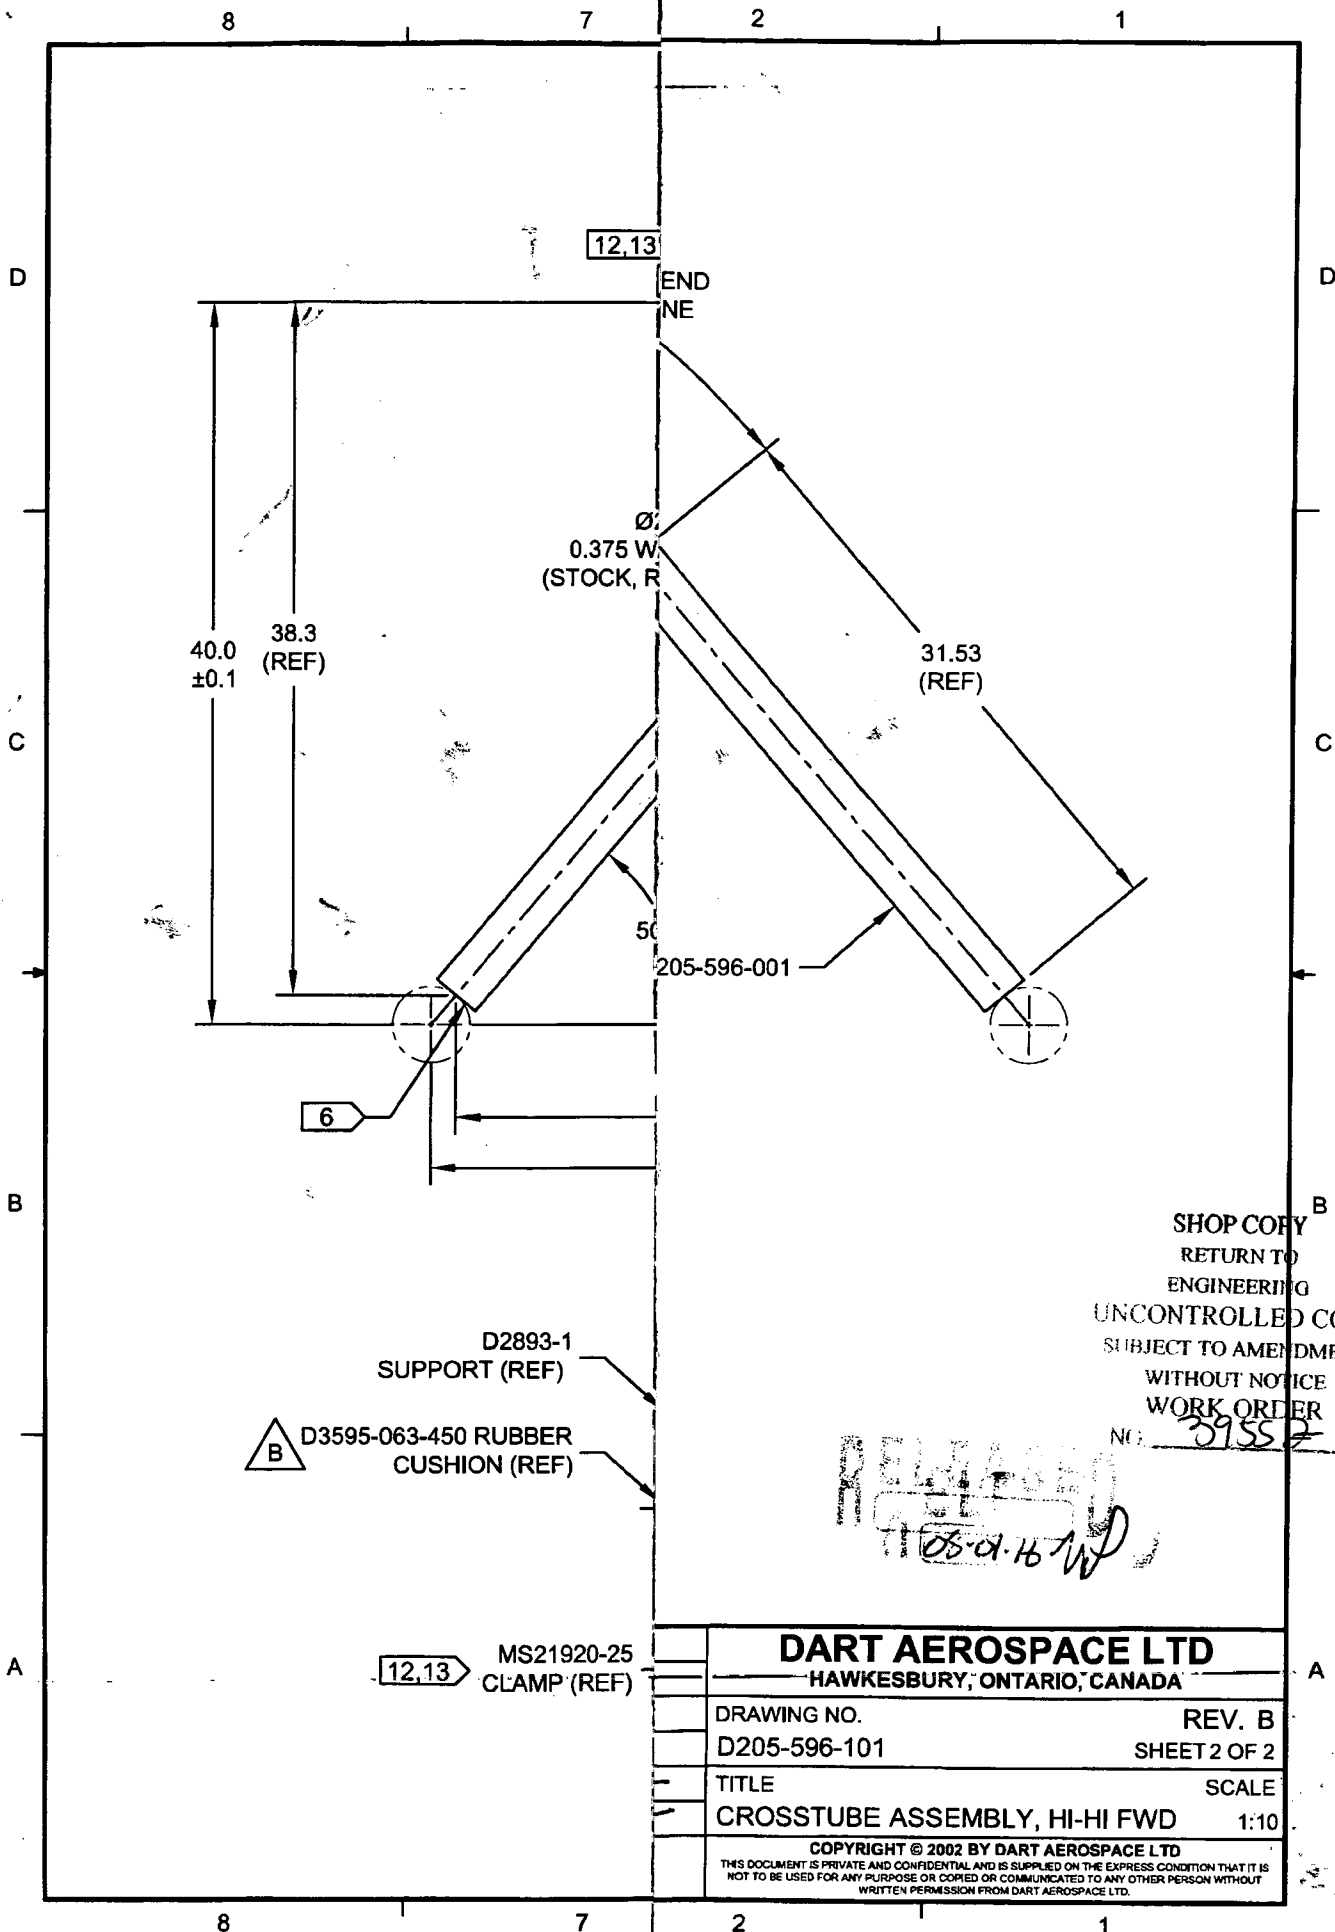

SHOP COPY
 RETURN TO
 ENGINEERING
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 WORK ORDER
 NO. 39552

RELEASED
 1105-01-16

12,13 MS21920-25
 CLAMP (REF)

DART AEROSPACE LTD
 HAWKESBURY, ONTARIO, CANADA

DRAWING NO. D205-596-101 REV. B
 SHEET 2 OF 2

TITLE CROSSTUBE ASSEMBLY, HI-HI FWD SCALE 1:10

COPYRIGHT © 2002 BY DART AEROSPACE LTD
 THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Date: Thursday, 29/05/2008 9:05:58 AM
 User: Julie Lescocq

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : FWD X-TUBE EXTENDED HEIGHT GEAR (-011)
 Job Number : 39552
 Estimate Number : 10007
 P.O. Number : Part Number : D205596101
 This Issue : 29/05/2008 S.O. No. : Drawing Number : D205-596-101
 Prsht Rev. : NC Project Number : N/A
 First Issue : / / Type : CROSSTUBES Drawing Revision : B
 Previous Run : 39551 Material :
 Due Date : 13/06/2008 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : JUD 08.5.29
 Comment : Est Rev G Removed Bending 05-10-25 JLM
 Est Rev H ECN 1075 08-01-10 DD
 Est Rev F 08.04.28 Added bending & mat'l EC
 verified by: DD

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



JUD 08.5.30



Comment: DOCUMENT CONTROL

Photocopy D205-594 bluefile & type labels per PPP D205-596-101 CHG002

2.0 D6005180 Crosstube Material



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Crosstube Material

Batch: _____

3.0 BENDING BENDING MACHINE - SKIDTUBES



Comment: BENDING MACHINE

Bend as per Dwg D2889 using CNC bender program

4.0 CROSSTUBES CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Mark 31.53" for cutting from tangential line in the straight section from D2889 as per Dwg wall template.

Identify off-cuts with batch number & part number and bring them to cnc lathe

5.0 QC15 DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES